

FRAISES

Fraises à graver

Gravierfräser

Engraving mills

Frese a incidere

2

2

0

6

1

5

B

220.615


220.615B

MD
HM/SC
MG KUF12

Fraises
Fräser
End mills
Frese




Z1



30° - 40°

50° - 60°

TiCN

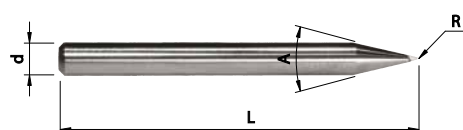

OPTI
cut

Norme OPTI

Angle	Rayon	d _{h5}	L	Non revêtu	Revêtu TiCN
30°	0.04	3	33	220.615-030-0.04	220.615B-030-0.04
	0.05	3	33	220.615-030-0.05	220.615B-030-0.05
	0.07	3	33	220.615-030-0.07	220.615B-030-0.07
	0.1	3	33	220.615-030-0.1	220.615B-030-0.1
40°	0.04	3	33	220.615-040-0.04	220.615B-040-0.04
	0.05	3	33	220.615-040-0.05	220.615B-040-0.05
	0.07	3	33	220.615-040-0.07	220.615B-040-0.07
	0.1	3	33	220.615-040-0.1	220.615B-040-0.1
50°	0.04	3	33	220.615-050-0.04	220.615B-050-0.04
	0.05	3	33	220.615-050-0.05	220.615B-050-0.05
	0.07	3	33	220.615-050-0.07	220.615B-050-0.07
	0.1	3	33	220.615-050-0.1	220.615B-050-0.1
60°	0.04	3	33	220.615-060-0.04	220.615B-060-0.04
	0.05	3	33	220.615-060-0.05	220.615B-060-0.05
	0.07	3	33	220.615-060-0.07	220.615B-060-0.07
	0.1	3	33	220.615-060-0.1	220.615B-060-0.1

INEO
Tech
>>> p 140